Door Schedule

No.	Height	Width	Thickness	U.L. Rate	Hardware. Lock	Self-Close	Panic
1	7'-0"	3'-0"	1 3/4"	20 min.	●	●	—
2	"	"	1 3/4"	20 min	●	●	—
3			1 3/8"	——	—	—	—
4			1 3/8"	——	—	—	—
5			1 3/4	20 min.	●	●	←
6			"	20 min	●	●	—
7			"	——	●	●	●
8			"	——	●	●	—
9			1 3/4"	20 min.	●	●	—
10			1 3/8"	——	—	—	—
11			1 3/8"	——	—	—	—
12			1 3/4"	20 min.	●	●	—
13		"	"	"	●	●	—
14		3'-0"			●	●	—
15	7'-0"	2'-6"			●	●	—
16	6'-8"	2'-6"	"	"	●	●	—
17	7'-0"	3'-0"	1 3/4	20 min.	●	●	—
18	"	"	1 3/8	——	●	——	—
19			1 3/4"	20 min	●	●	—
20			1 3/4"	20 min.	●	●	—
21			1 3/4"	20 min.	●	●	—
22			1 3/8"	——	—	—	—
23	"	"	1 3/8"	——	—	——	—
24	7'-0"	3'-0"	1 3/4"	——	●	●	—
25	Existing				●	●	●
26	7'-0"	6'-0" Pair	1 3/4"	——	●	●	—

Window Schedule

Mk.	Size	Type	Material	Glass	Remarks
A	3'-5" x 3'-6"	Fixed	Alum	1/4 PPG	Verify Size
B	5'-4" x 3'-6"				
C	3'-8" x 3'-6"				
D	4'-8" x 3'-6"				
E	6'-0" x 3'-6"				

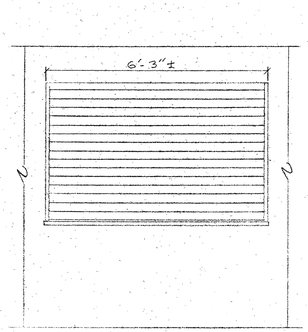

Elevation

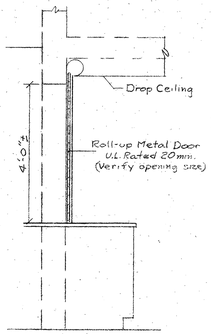

Section

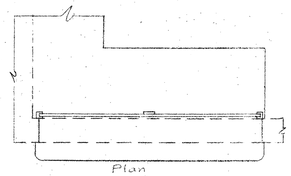
Plan

Kitchen Window Detail 1/2" = 1'-0" (7)

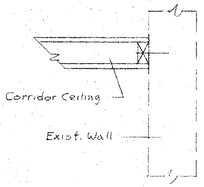

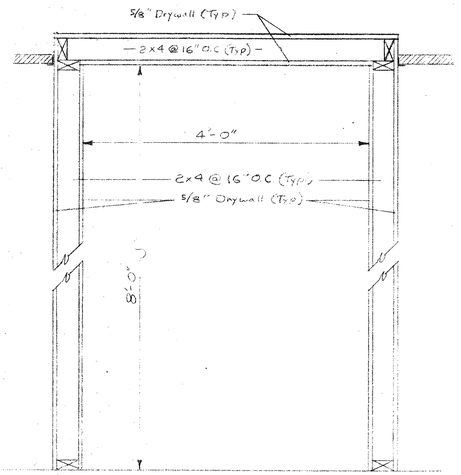

Corridor Detail 1" = 1'-0" (6)

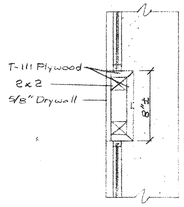

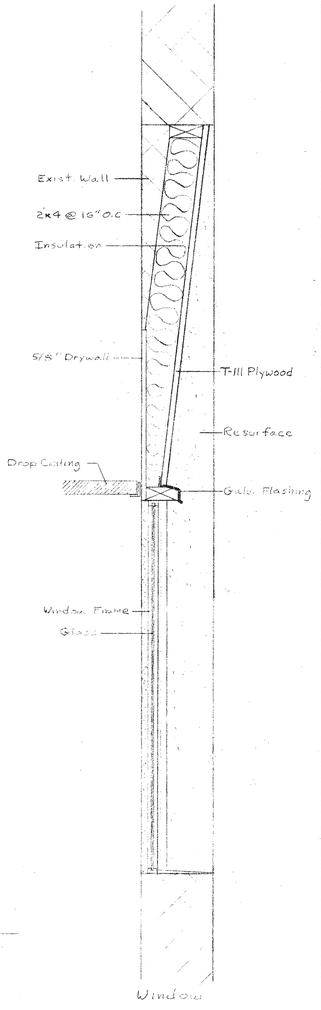

Wall & Window Detail 1/2" = 1'-0" (4)

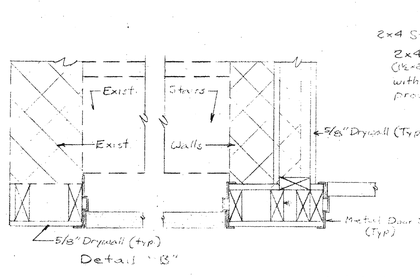

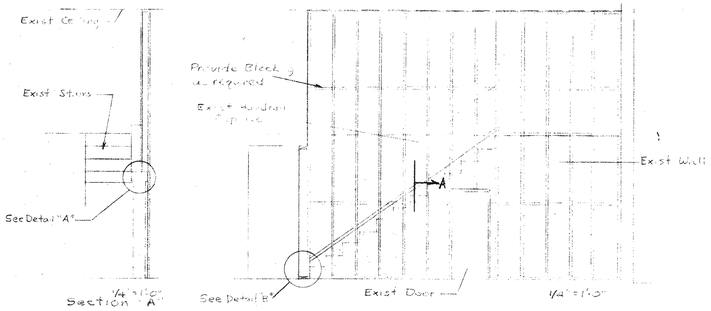

Stairwell Detail (5)

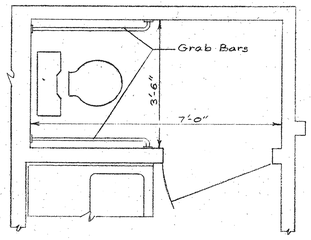

Restroom Detail 1/2" = 1'-0" (8)-(8A)

Reverse for 8A

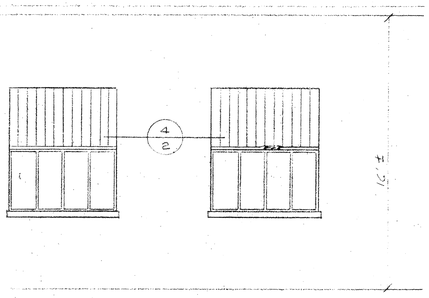

Partial West Elevation 1/4" = 1'-0" (2)

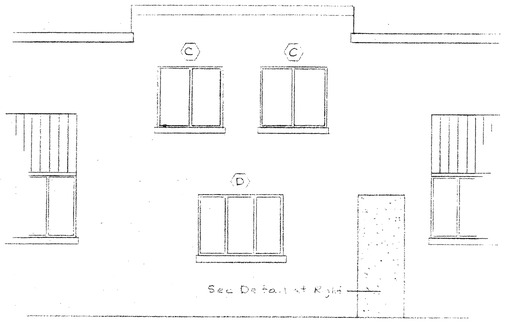

Partial South Elevation 1/4" = 1'-0" (1)

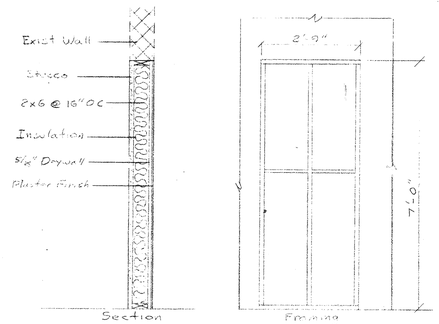

Door Closure Detail 1/2" = 1'-0" (3)

Park and Recreation Department Pre-Copy

	Eastside Social Service Center Pre-School	Elevations, Details, Schedules
		M-227 A-2

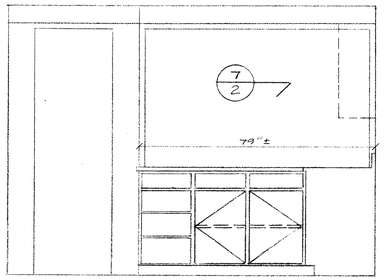

North Wall

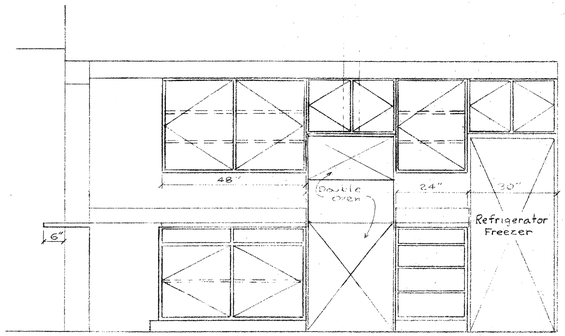

East Wall

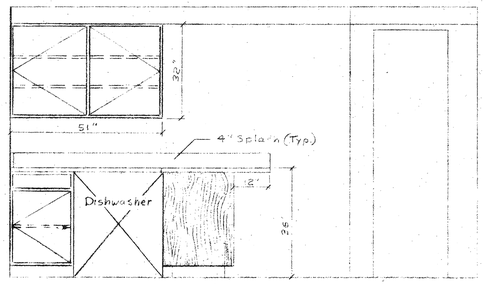

West Wall

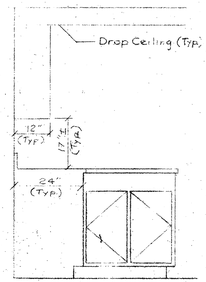

Center-North View

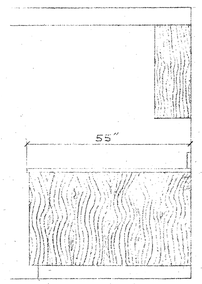

Center-South View

Kitchen Cabinets 1/2" = 1'-0" 1

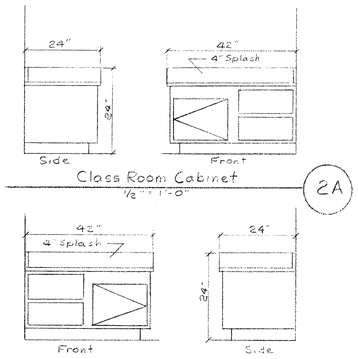

Class Room Cabinet 1/2" = 1'-0" 2A

Class Room Cabinet 1/2" = 1'-0" 2

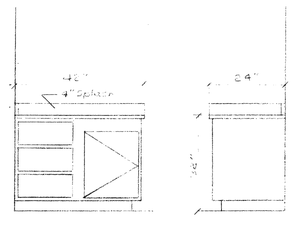

Nurse Cabinet 1/2" = 1'-0" 3

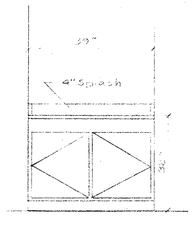

Restroom Cabinet 1/2" = 1'-0" 4

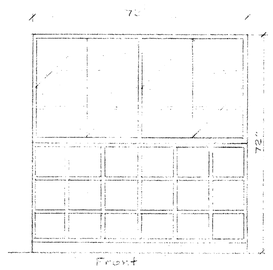

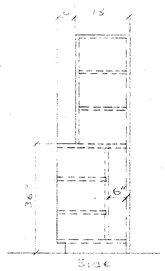

Class Room Storage - Portable 1/2" = 1'-0" 5

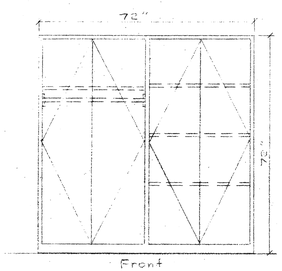

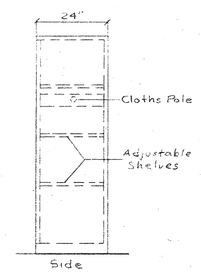

Office Storage - Portable 1/2" = 1'-0" 6

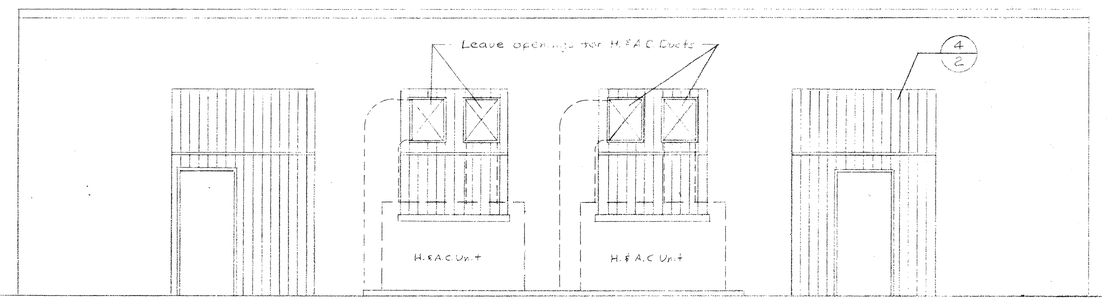

East Elevation 1/4" = 1'-0" 7

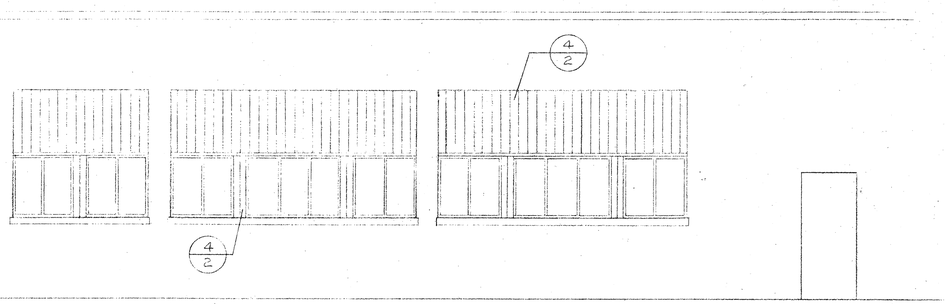

Partial North Elevation 1/4" = 1'-0" 8

Park and Recreation
Permanent File Copy

	Eastside Social Service Center Pre-School	Cabinet Details, Elevations

M-227
A-3

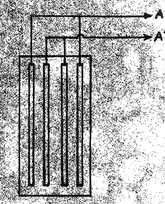

Wiring Diagram for Multi-Level Lighting

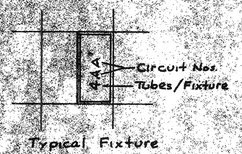

Typical Fixture

Lighting & Drop Ceiling Notes

1) Fixtures 2K & 2I shall be surface mount, all others to be recessed into drop ceiling.
2) Restroom lights may be either incandescent (15W) or fluorescent type.
3) All drop ceiling fixtures shall be attached to safety wires (2/fixture) supplied by drop ceiling Contractor.
4) Ceiling grid pattern may be adjusted slightly for better installation, with Engineer's approval.
5) All fluorescent fixtures shall be supplied with acrylic lens.

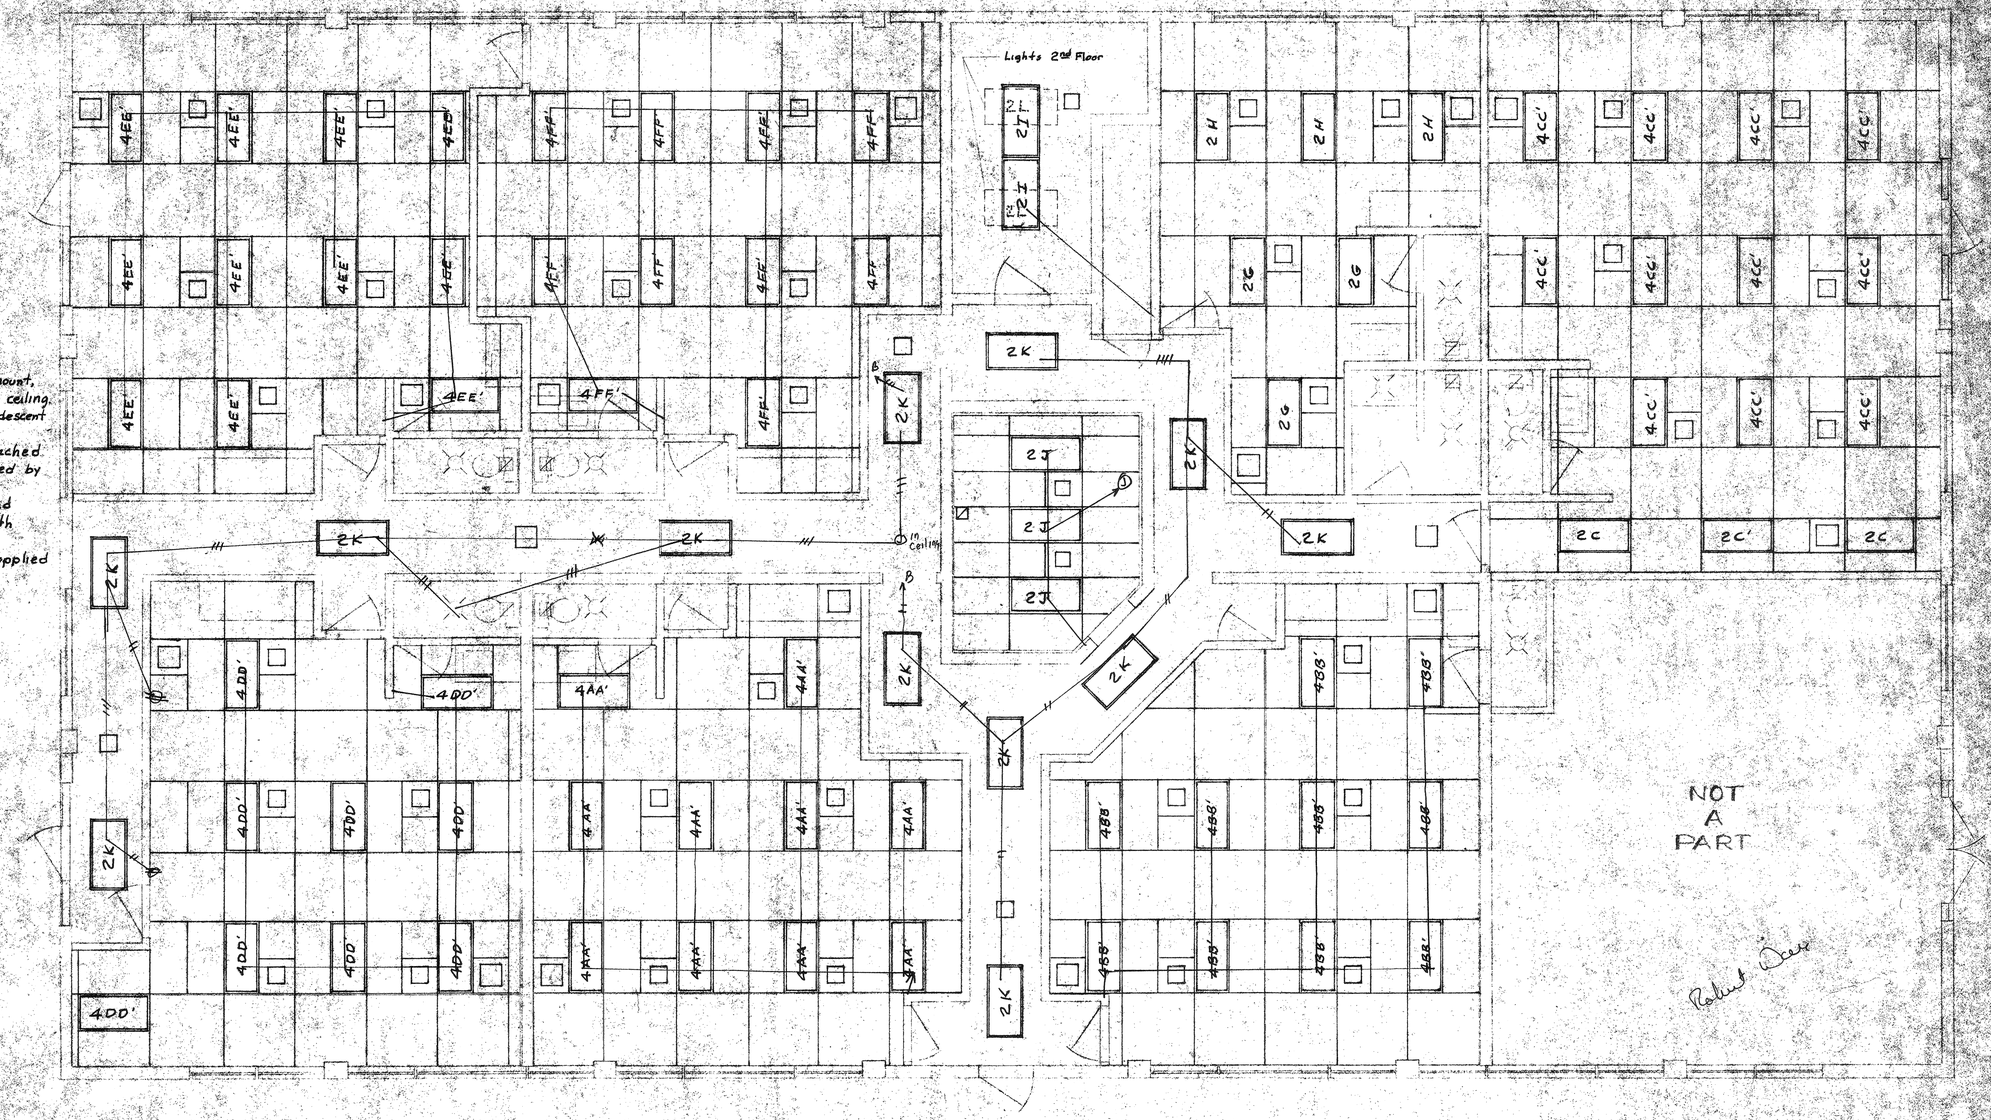

	Eastside Social Service Center Pre-School	Lighting & Reflected Ceiling Plan

M-227
A-4

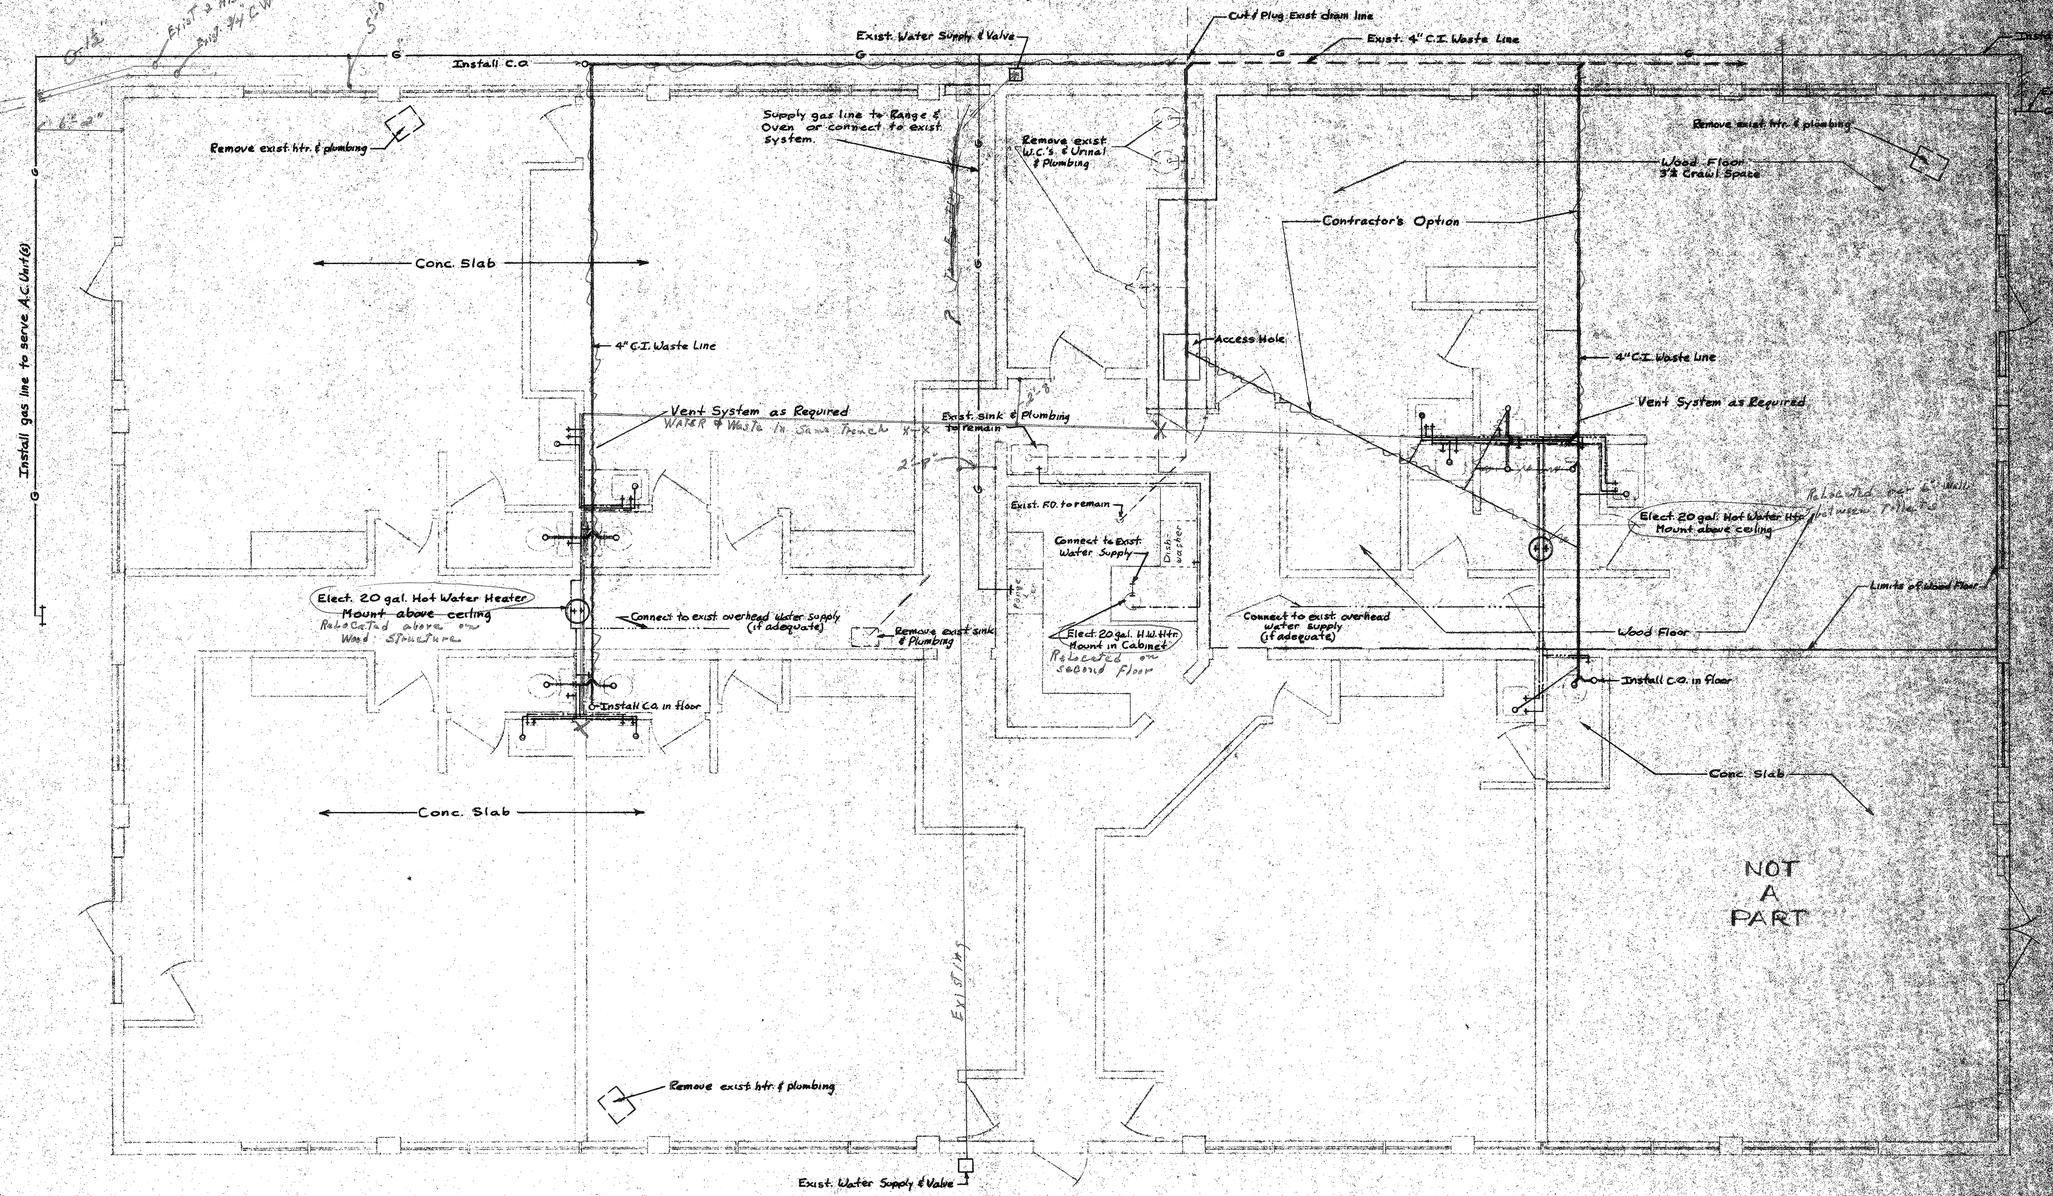

Plumbing Notes

Removals - Fixtures to be removed shall be removed in good condition and turned over to the City. Existing plumbing shall then be cut and capped above ceiling line and plugged below finish floor. All abandoned systems (gas & water) shall be removed where possible. Remaining lines may be plugged flush with existing walls. All exterior lines abandoned shall be removed and plugged below grade line.

New Installations - All water, vent, waste, & gas plumbing shall be sized to meet all code requirements and for proper operation. Alternate routes may be used in place of those shown. It shall be this contractor's responsibility to trench for waste lines and/or other plumbing items as required. All trenches shall be backfilled and properly compacted. Finish floor shall be the General Contractor's responsibility, as well as concrete removal & saw cutting.

	Eastside Social Service Center Pre-School	Plumbing	M-22 P-1

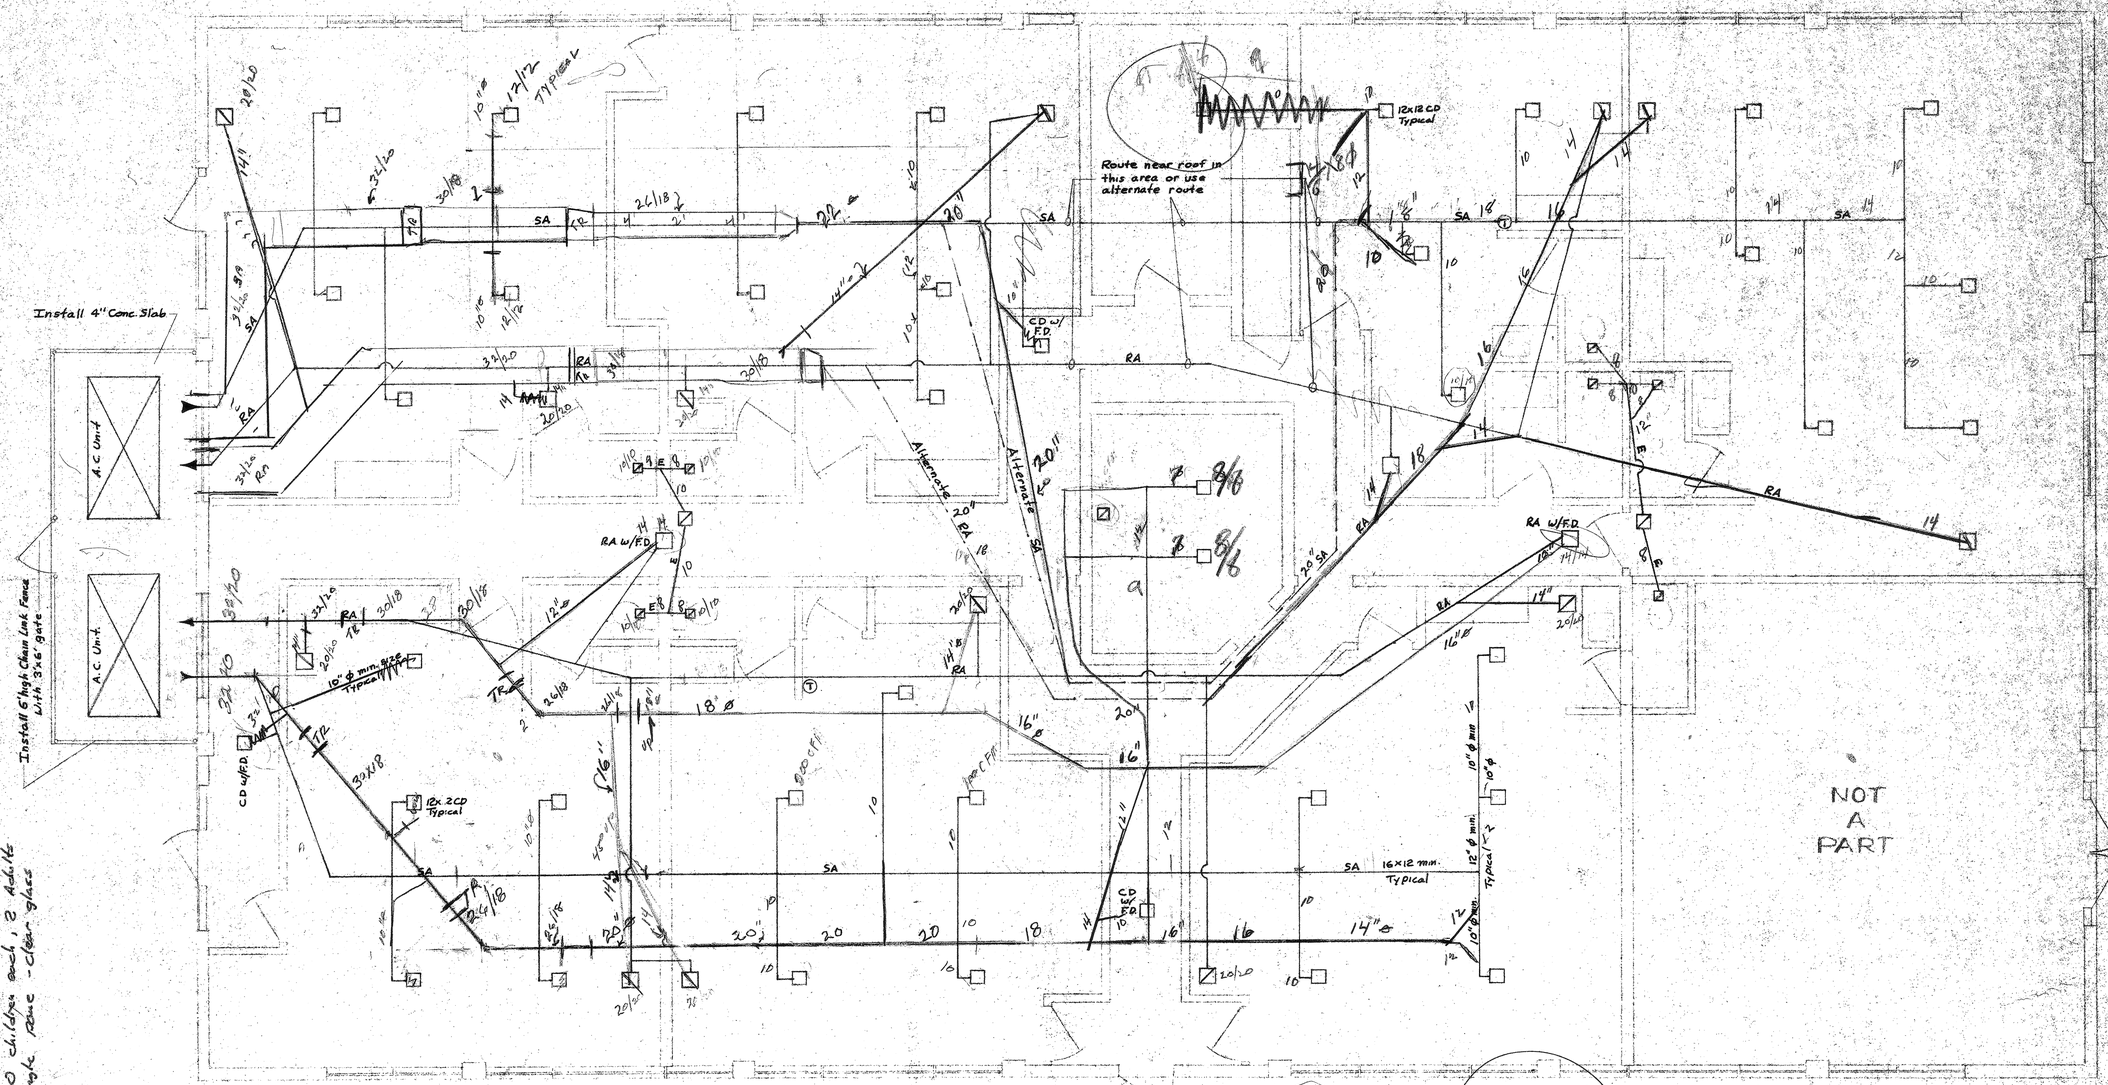

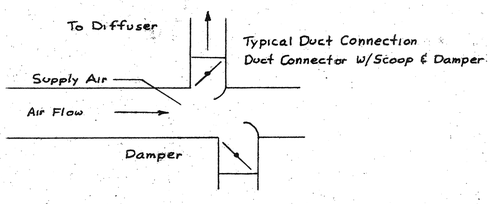

Duct Take-Off Detail N.T.S.

15½ x 15½ Hall way opening

Heating & Air Conditioning Notes

Contractor shall size H&A.C. Unit(s), duct, no. of CD's, Return Air, and Exhaust as per code requirements and for proper operation. Alternate routes may be used rather than those shown. All corridor penitrations shall be protected with Fire Dampers.

Design information
Typical Class size - 30 children each, 2 Adults
All windows are single pane - clear glass

Park and Recreation Permanent File Copy

	Eastside Social Service Center Pre-School	Heat, Vent, & Air Conditioning	M-227 M-1

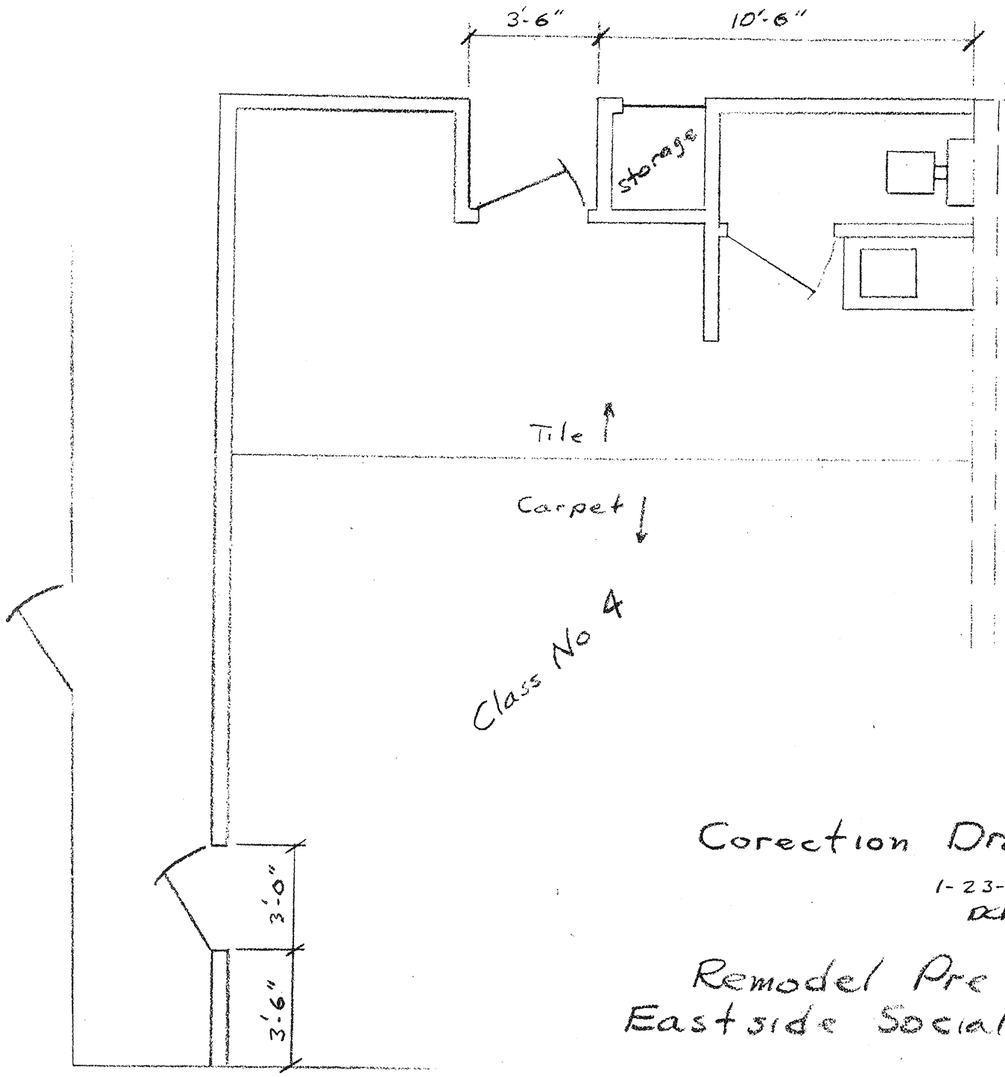

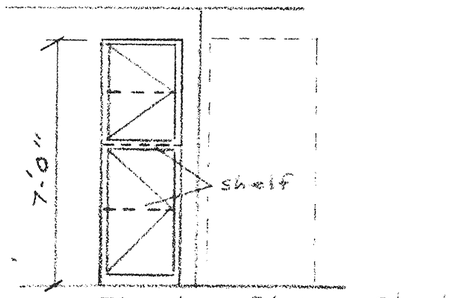

Elevation Storage Closet

Doors & Trim to be
Painted Plywood (semi-gloss)

Corection Drawing # 1

1-23-79
DLK

Remodel Pre School
Eastside Social Service Center

Park and Recreation
Permanent File Copy

JAN 23 1979