



Revision



STEEL PEDESTAL JUNCTION CABINET INSTALLATION

UGS

REVISION: Updated: Conduit Depth


REVISION DATE: 10/24/08

APPROVED BY: *George Somoano*

APPROVED DATE: 10/31/08

PREPARED BY: JRS

CHECKED BY: WEM

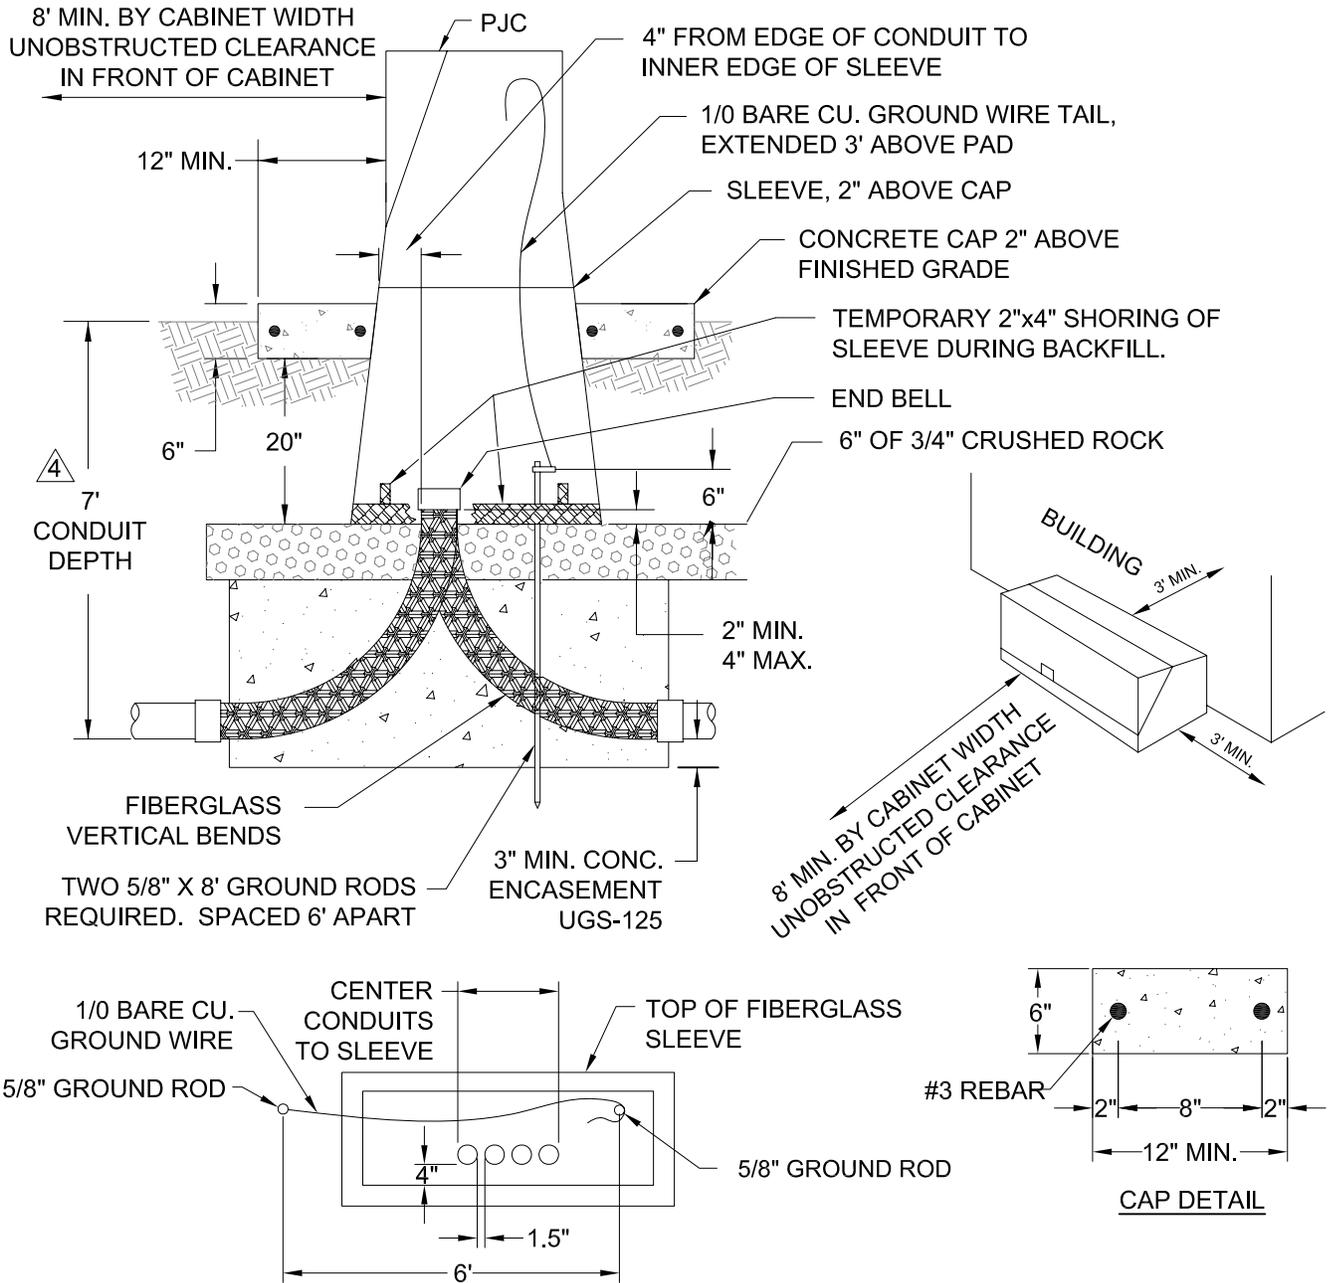

Notes:

1. Conduits to be aligned in a row per Department Inspector's direction.
2. Group bond wire per UGS-621.1, 722, or 723.
3. PJC sleeve is provided by the Department and installed by the Developer.
4. Conduit sweeps shall be encased with concrete per UGS-125 and UGS-015 mix # 4003.
5. The developer shall install a 12" min. concrete cap, UGS-015 mix #4003, around the PJC. See detail above.
6. No telecommunication conduit is to be installed in the PJC.
7. Barrier posts are required per UGS-290
8. For Typical PJC locations, see UGS-730.
9. Refer to UGS-225 for grounding.
10. Contractor shall provide temporary 2"x4" shoring during backfill. Backfill shall be a 1 sack slurry mix.
11. Two 5/8" ground rods are required. To be spaced 6' apart
12. Vertical bends shall be fiberglass.



Revision



STEEL PEDESTAL JUNCTION CABINET INSTALLATION

UGS

REVISION: Updated: New Format



REVISION DATE: 10/24/08

APPROVED BY: *Jorge Somoano*

APPROVED DATE: 10/31/08

PREPARED BY: JRS

CHECKED BY: WEM

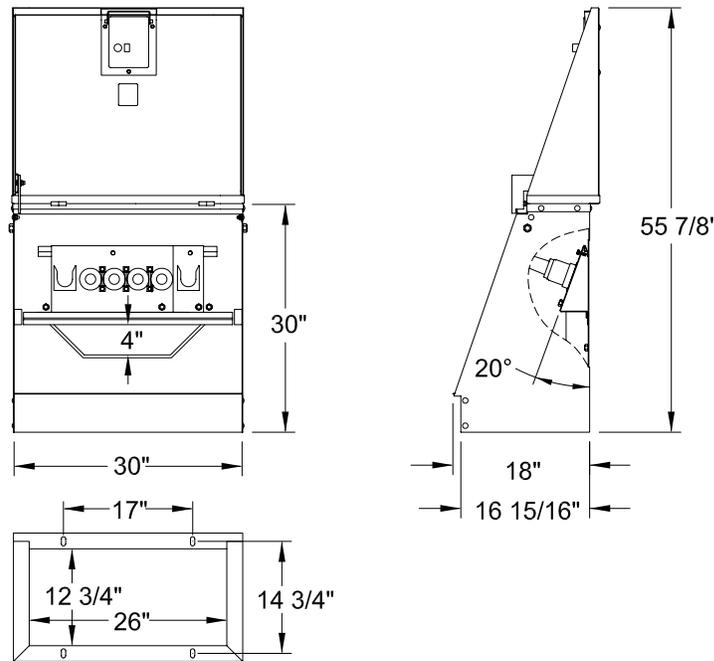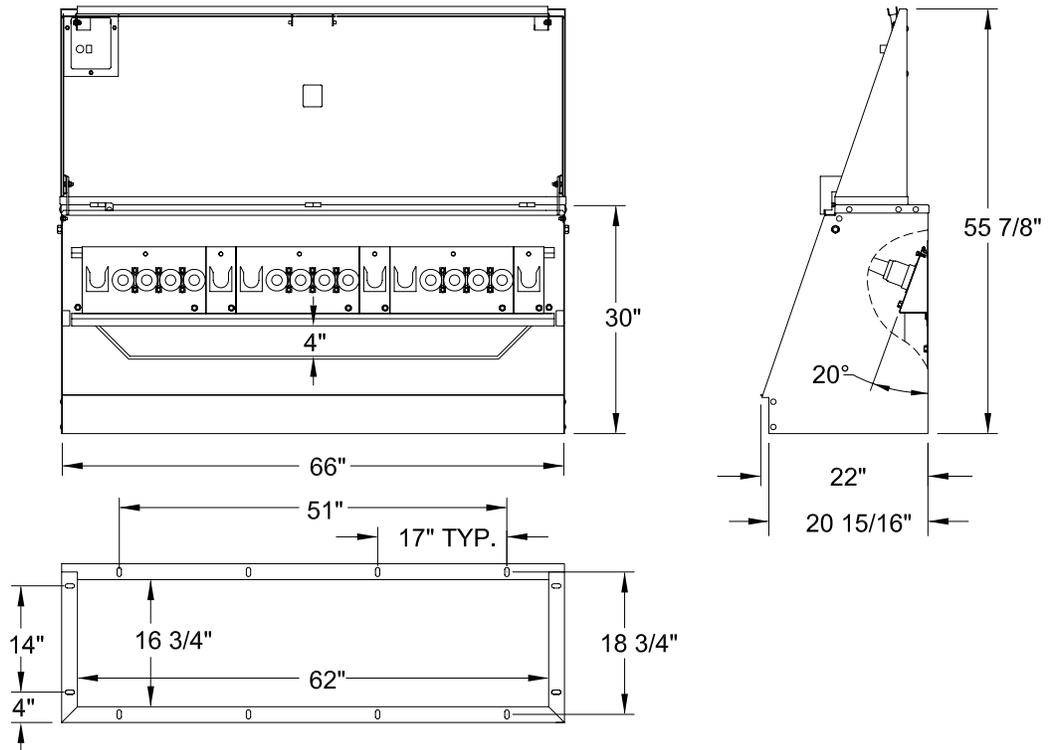

Notes:

- 1. Allowance has been made for small dimension variations by different manufacturers.